

SRBC's interstate monitoring program began in April 1986. For the first five years, results were reported for water years that ran from October to September. In 1991, SRBC changed the reporting periods to correspond with its fiscal year that covers the period from July to June. This report is presented for fiscal year 2005, which covers July 1, 2004, to June 30, 2005.

BASIN GEOGRAPHY

The Susquehanna River Basin is the largest river basin on the Atlantic Coast of the United States, draining 27,500 square miles. The Susquehanna River originates at the outlet of Otsego Lake, Cooperstown, NY, and flows 444 miles through New York, Pennsylvania, and Maryland to the Chesapeake Bay at Havre de Grace, MD. Eighty-three streams cross state lines in the basin (Table 1). Several streams traverse the state lines at multiple points, contributing to 91 crossings. Of those 91 crossings, 45 streams flow from New York into Pennsylvania, 22 from Pennsylvania into New York, 15 from Pennsylvania into Maryland, and nine from Maryland into Pennsylvania. Many streams are small, and 32 are unnamed.

METHODS

Field and Laboratory Methods

Sampling frequency

In Water Year 1989, the interstate streams were divided into three groups, according to the degree of water quality impairment, historical water quality impacts, and potential for degradation. These groupings were determined based on historical water quality and land use. To date, these groups remain consistent and are described below.

Streams with impaired water quality or judged to have a high potential for degradation due to large drainage areas or historical pollution were assigned to Group 1. During sampling period 2004-2005, NY-PA Group 1 streams were sampled July through September (depending on flow conditions), October, February, and May. Pennsylvania-Maryland Group 1 stations were sampled July or August, October, February, and May. Benthic macroinvertebrates were collected and habitat assessments were performed in Group 1 streams during July and August 2004.

Streams judged to have a moderate potential for impacts were assigned to Group 2. Water quality samples, benthic macroinvertebrate samples, and physical habitat information were obtained from Group 2 stations once a year; preferably during base flow conditions in the summer months. In this sampling period, water chemistry, macroinvertebrate, and physical habitat information were collected during July and August 2004.

Table 1. Interstate Streams in the Susquehanna River Basin

Stream Name	Monitoring Group	Flow Direction (from→to)
<i>Streams Along the New York–Pennsylvania Border</i>		
Apalachin Creek	2	PA→NY
Babcock Run	3	NY→PA
Beagle Hollow	3	NY→PA
Bentley Creek	1	PA→NY
Bill Hess Creek	3	NY→PA
Bird Creek	3	PA→NY
Biscuit Hollow	3	NY→PA
Briggs Hollow Run	3	NY→PA
Bulkley Brook	3	NY→PA
Camp Brook	3	NY→PA
Cascade Creek	1	NY→PA
Cayuta Creek	1	NY→PA
Chemung River	1	NY→PA→NY→PA
Choconut Creek	2	PA→NY
Cook Hollow	3	NY→PA
Cowanesque River	1	PA→NY
Deep Hollow Brook	3	NY→PA
Denton Creek	3	NY→PA
Dry Brook*	3	NY→PA
Holden Creek	2	NY→PA
Little Snake Creek	1	PA→NY
Little Wappasening Creek	3	PA→NY
North Fork Cowanesque River	2	NY→PA
Parks Creek	3	PA→NY
Prince Hollow Run	3	NY→PA
Russell Run	3	NY→PA
Sackett Creek	3	PA→NY
Seeley Creek	1	PA→NY
Smith Creek	3	PA→NY
Snake Creek	2	PA→NY
South Creek	2	PA→NY
Strait Creek	3	NY→PA
Susquehanna River	1	NY→PA→NY→PA
Tioga River	1	PA→NY
Troups Creek	1	NY→PA
Trowbridge Creek	2	NY→PA
Wappasening Creek	2	PA→NY
White Branch	3	NY→PA
White Hollow	3	PA→NY
17 Unnamed tributaries*	3	NY→PA
2 Unnamed tributaries*	3	PA→NY
2 Unnamed tributaries*	3	PA→NY→PA

*Not sampled in 2004-2005

Table 1. Interstate Streams in the Susquehanna River Basin—Continued

Stream Name	Monitoring Group	Flow Direction (from→to)
<i>Streams Along The Pennsylvania–Maryland Border</i>		
Big Branch Deer Creek	2	PA→MD
Conowingo Creek	1	PA→MD
Deer Creek	1	PA→MD
Ebaughs Creek	1	PA→MD
Falling Branch Deer Creek	2	PA→MD
Island Branch*	3	PA→MD
Long Arm Creek	1	MD→PA
Octoraro Creek	1	PA→MD
Scott Creek	1	MD→PA
South Branch Conewago Creek	2	MD→PA
Susquehanna River	1	PA→MD
6 Unnamed tributaries*	3	MD→PA
7 Unnamed tributaries*	3	PA→MD

*Not sampled in 2004-2005

Streams judged to have a low potential for impacts were assigned to Group 3 and were visually inspected only for signs of degradation once a year until fiscal year 2000 when the biological and habitat conditions of these streams were assessed during May. Field chemistry parameters also were measured on Group 3 streams at the time of biological sampling. New York-Pennsylvania border and PA-MD border stream stations sampled during fiscal year 2005 are listed in Tables 2 and 3, respectively, and are depicted in Figures 1 through 4.

Stream discharge

Stream discharge was measured at all stations unless high stream flows made access impossible. Several stations are located near U.S. Geological Survey (USGS) stream gages. These stations include the following: the Susquehanna River at Windsor, NY, Kirkwood, NY, Sayre, PA, Marietta, PA, and Conowingo, MD; the Chemung River at Chemung, NY; the Tioga River at Lindley, NY; and the Cowanesque River at Lawrenceville, PA. Recorded stages from USGS gaging stations and rating curves were used to determine instantaneous discharges in cubic feet per second (cfs). Instantaneous discharges for stations not located near USGS gaging stations were measured at the time of sampling, using standard USGS procedures (Buchanan and Somers, 1969). Stream discharges are tabulated according to station name and date in Appendix A.

Water samples

Water samples were collected at each of the sites to measure nutrient and metal concentrations. Chemical and physical parameters monitored are listed in Table 4. Water samples were collected using a depth-integrated sampler. Composite samples were obtained by collecting several depth-integrated samples across the stream channel and combining them in a churn splitter that was previously rinsed with stream water. Water samples were mixed thoroughly in the churn splitter and collected in a 500-ml bottle and two 250-ml bottles. The 500-ml bottle was for a raw sample. Each of the 250-ml bottles consisted of a whole water sample, one fixed with concentrated nitric acid (HNO₃) for metal analysis and one fixed with concentrated sulfuric acid (H₂SO₄) for nutrient analysis. The samples were chilled on ice and sent to the Pennsylvania Department of Environmental Protection (PADEP), Bureau of Laboratories in Harrisburg, PA, within 24 hours of collection.

Field chemistry

Temperature, dissolved oxygen, conductivity, pH, alkalinity, and acidity were measured in the field. Dissolved oxygen was measured using a YSI model 55-dissolved oxygen meter that was calibrated at the beginning of each day when water samples were collected. A VWR Scientific Model 2052 conductivity meter was used to measure conductivity. A Cole Parmer meter was used to measure pH. The pH meter was calibrated at the beginning of the day and randomly checked throughout the day. Alkalinity was determined by titrating a known volume of water to pH 4.5 with 0.02N H₂SO₄. Acidity was measured by titrating a known volume of sample water to pH 8.3 with 0.02N sodium hydroxide (NaOH). Total chlorine was measured at Cayuta and Ebaughs Creeks since CAYT 1.7 and EBAU 1.5 were located downstream of wastewater treatment plants. A HACH Datalogging Colorimeter model DR/890 was used with the DPD Test and Tube method (10101) to measure chlorine concentrations.

Table 2. Stream Stations Sampled Along the New York–Pennsylvania Border and Sampling Rationale

Station	Stream and Location	Monitoring Group	Rationale
APAL 6.9	Apalachin Creek, Little Meadows, PA	2	Monitor for potential water quality impacts
BABC	Babcock Run, Cadis, PA	3	Monitor for potential impacts
BEAG	Beagle Hollow Run, Osceola, PA	3	Monitor for potential impacts
BILL	Bill Hess Creek, Nelson, PA	3	Monitor for potential impacts
BIRD	Bird Creek, Webb Mills, NY	3	Monitor for potential impacts
BISC	Biscuit Hollow, Austinburg, PA	3	Monitor for potential impacts
BNTY 0.9	Bentley Creek, Wellsburg, NY	1	Monitor for potential water quality impacts
BRIG	Briggs Hollow, Nichols, NY	3	Monitor for potential impacts
BULK	Bulkley Brook, Knoxville, PA	3	Monitor for potential impacts
CAMP	Camp Brook, Osceola, PA	3	Monitor for potential impacts
CASC 1.6	Cascade Creek, Lanesboro, PA	1	Monitor for potential water quality impacts
CAYT 1.7	Cayuta Creek, Waverly, NY	1	Municipal discharge from Waverly, NY
CHEM 12.0*	Chemung River, Chemung, NY	1	Municipal and industrial discharges from Elmira, NY
CHOC 9.1	Choconut Creek, Vestal Center, NY	2	Monitor for potential water quality impacts
COOK	Cook Hollow, Austinburg, PA	3	Monitor for potential impacts
COWN 2.2	Cowanesque River, Lawrenceville, PA	1	Impacts from flood control reservoir
COWN 1.0	Cowanesque River, Lawrenceville, PA	1	Recovery zone from upstream flood control reservoir
DEEP	Deep Hollow Brook, Danville, NY	3	Monitor for potential impacts
DENT	Denton Creek, Hickory Grove, PA	3	Monitor for potential impacts
DRYB*	Dry Brook, Waverly, NY	3	Monitor for potential impacts
HLDN 3.5	Holden Creek, Woodhull, NY	2	Monitor for potential water quality impacts
LSNK 7.6	Little Snake Creek, Brackney, PA	1	Monitor for potential water quality impacts
LWAP	Little Wappasening Creek, Nichols, NY	3	Monitor for potential impacts
NFCR 7.6	North Fork Cowanesque River, North Fork, PA	2	Monitor for potential water quality impacts
PARK	Parks Creek, Litchfield, NY	3	Monitor for potential impacts
PRIN	Prince Hollow Run Cadis, PA	3	Monitor for potential impacts
RUSS	Russell Run, Windham, PA	3	Monitor for potential impacts
SACK	Sackett Creek, Nichols, NY	3	Monitor for potential impacts
SEEL 10.3	Seeley Creek, Seeley Creek, NY	1	Monitor for potential water quality impacts
SMIT	Smith Creek, East Lawrence, PA	3	Monitor for potential impacts
SNAK 2.3	Snake Creek, Brookdale, PA	2	Monitor for potential water quality impacts
SOUT 7.8	South Creek, Fassett, PA	2	Monitor for potential water quality impacts
STRA	Strait Creek, Nelson, PA	3	Monitor for potential impacts
SUSQ 365.0	Susquehanna River, Windsor, NY	1	Large drainage area (1,882 sq. mi.); municipal discharges from Cooperstown, Sidney, Bainbridge, and Oneonta
SUSQ 340.0*	Susquehanna River, Kirkwood, NY	1	Large drainage area (2,232 sq. mi.); historical pollution due to sewage from Lanesboro, Oakland, Susquehanna, Great Bend, and Hallstead
SUSQ 289.1*	Susquehanna River, Sayre, PA	1	Large drainage area (4,933 sq. mi.); municipal and industrial discharges
TIOG 10.8*	Tioga River, Lindley, NY	1	Pollution from acid mine discharges and impacts from flood control reservoirs
TRUP 4.5	Troups Creek, Austinburg, PA	1	High turbidity and moderately impaired macroinvertebrate populations
TROW 1.8	Trowbridge Creek, Great Bend, PA	2	Monitor for potential water quality impacts
WAPP 2.6	Wappasening Creek, Nichols, NY	2	Monitor for potential water quality impacts
WBCO	White Branch Cowanesque River, North Fork, PA	3	Monitor for potential impacts
WHIT	White Hollow, Wellsburg, NY	3	Monitor for potential impacts

*No macroinvertebrate sample collected in 2004-2005

Table 3. Stream Stations Sampled along the Pennsylvania–Maryland Border and Sampling Rationale

Station	Stream and Location	Monitoring Group	Rationale
BBDC 4.1	Big Branch Deer Creek, Fawn Grove, PA	2	Monitor for potential water quality impacts
CNWG 4.4	Conowingo Creek, Pleasant Grove, PA	1	High nutrient loads and other agricultural runoff; nonpoint runoff to Chesapeake Bay
DEER 44.2	Deer Creek, Gorsuch Mills, MD	1	Past pollution from Gorsuch Mills, MD, Stewartstown, PA; nonpoint runoff to Chesapeake Bay
EBAU 1.5	Ebaughs Creek, Stewartstown, PA	1	Municipal discharge from Stewartstown, PA; nonpoint runoff to Chesapeake Bay
FBDC 4.1	Falling Branch Deer Creek, Fawn Grove, PA	2	Monitor for potential water quality impacts
LNGA 2.5	Long Arm Creek, Bandanna, PA	1	Monitor for potential water quality impacts
OCTO 6.6	Octoraro Creek, Rising Sun, MD	1	High nutrient loads due to agricultural runoff from New Bridge, MD; water quality impacts from Octoraro Lake; nonpoint runoff to Chesapeake Bay
SBCC 20.4	South Branch Conewago Creek, Bandanna, PA	2	Monitor for potential water quality impacts
SCTT 3.0	Scott Creek, Delta, PA	1	Historical pollution due to untreated sewage
SUSQ 44.5*	Susquehanna River, Marietta, PA	1	Bracket hydroelectric dams near the state line
SUSQ 10.0*	Susquehanna River, Conowingo, MD	1	Bracket hydroelectric dams near the state line

* No macroinvertebrate sample collected in 2004-2005

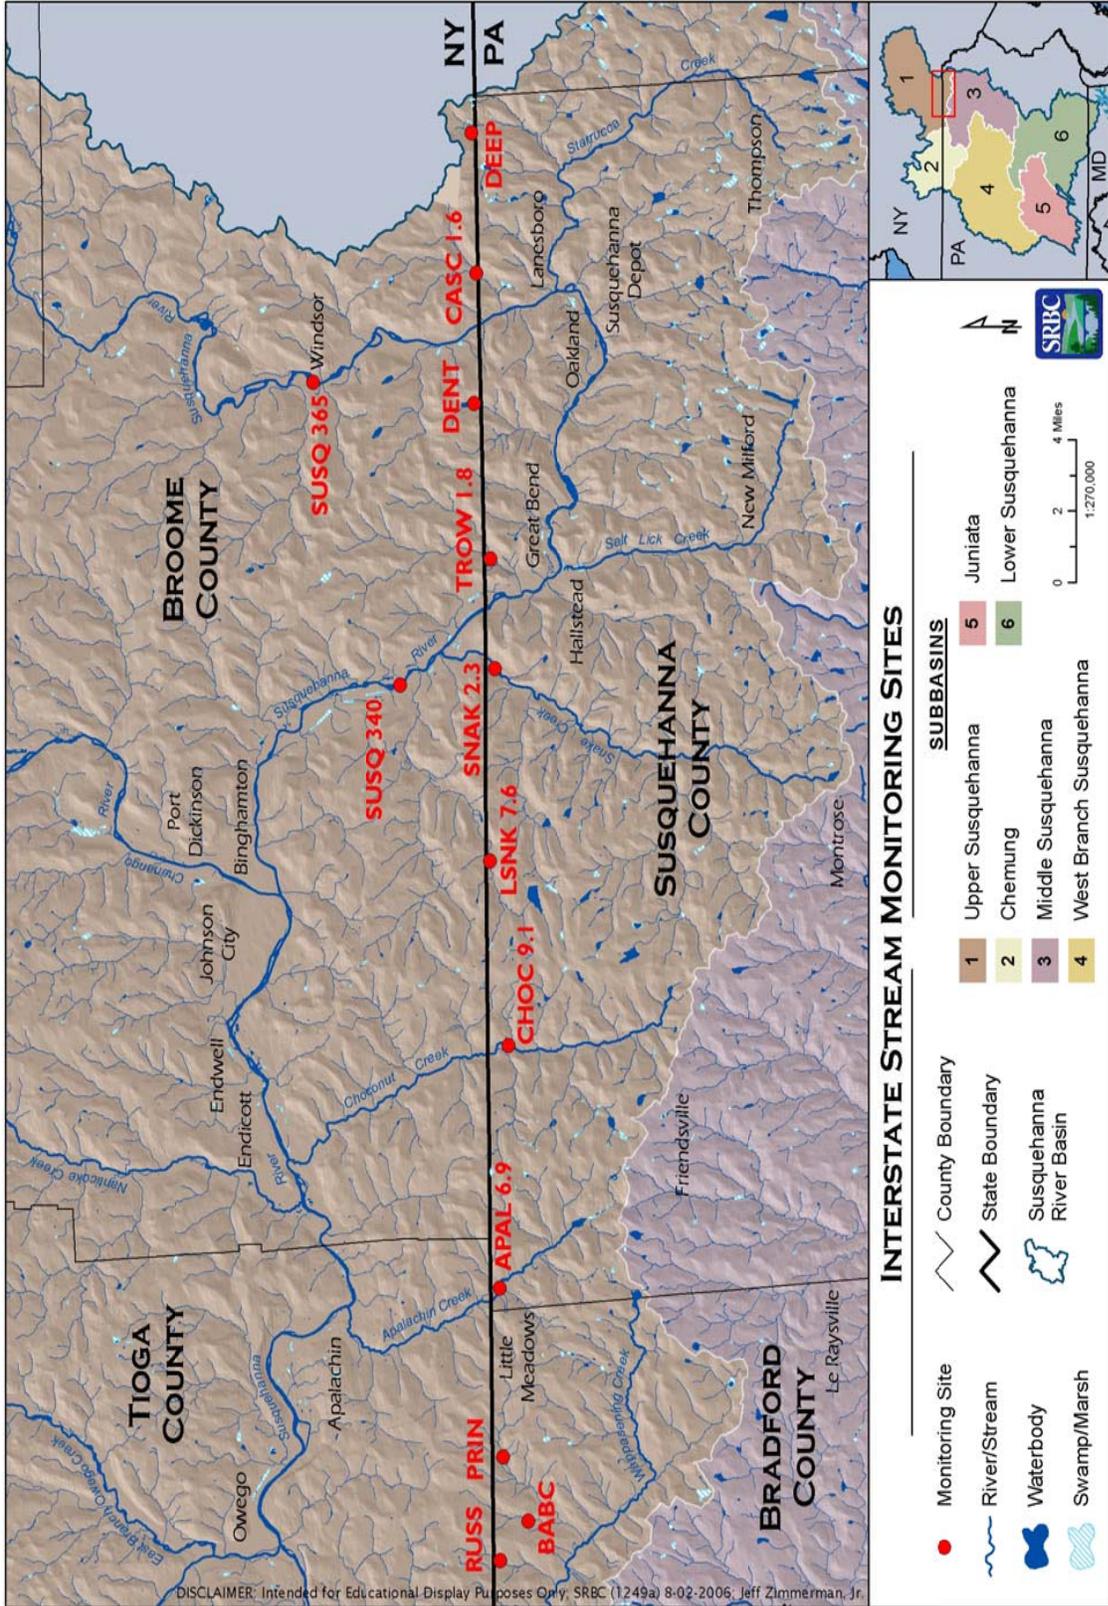


Figure 1. Interstate Streams Along the New York-Pennsylvania Border Between Russell Run and Deep Hollow Brook

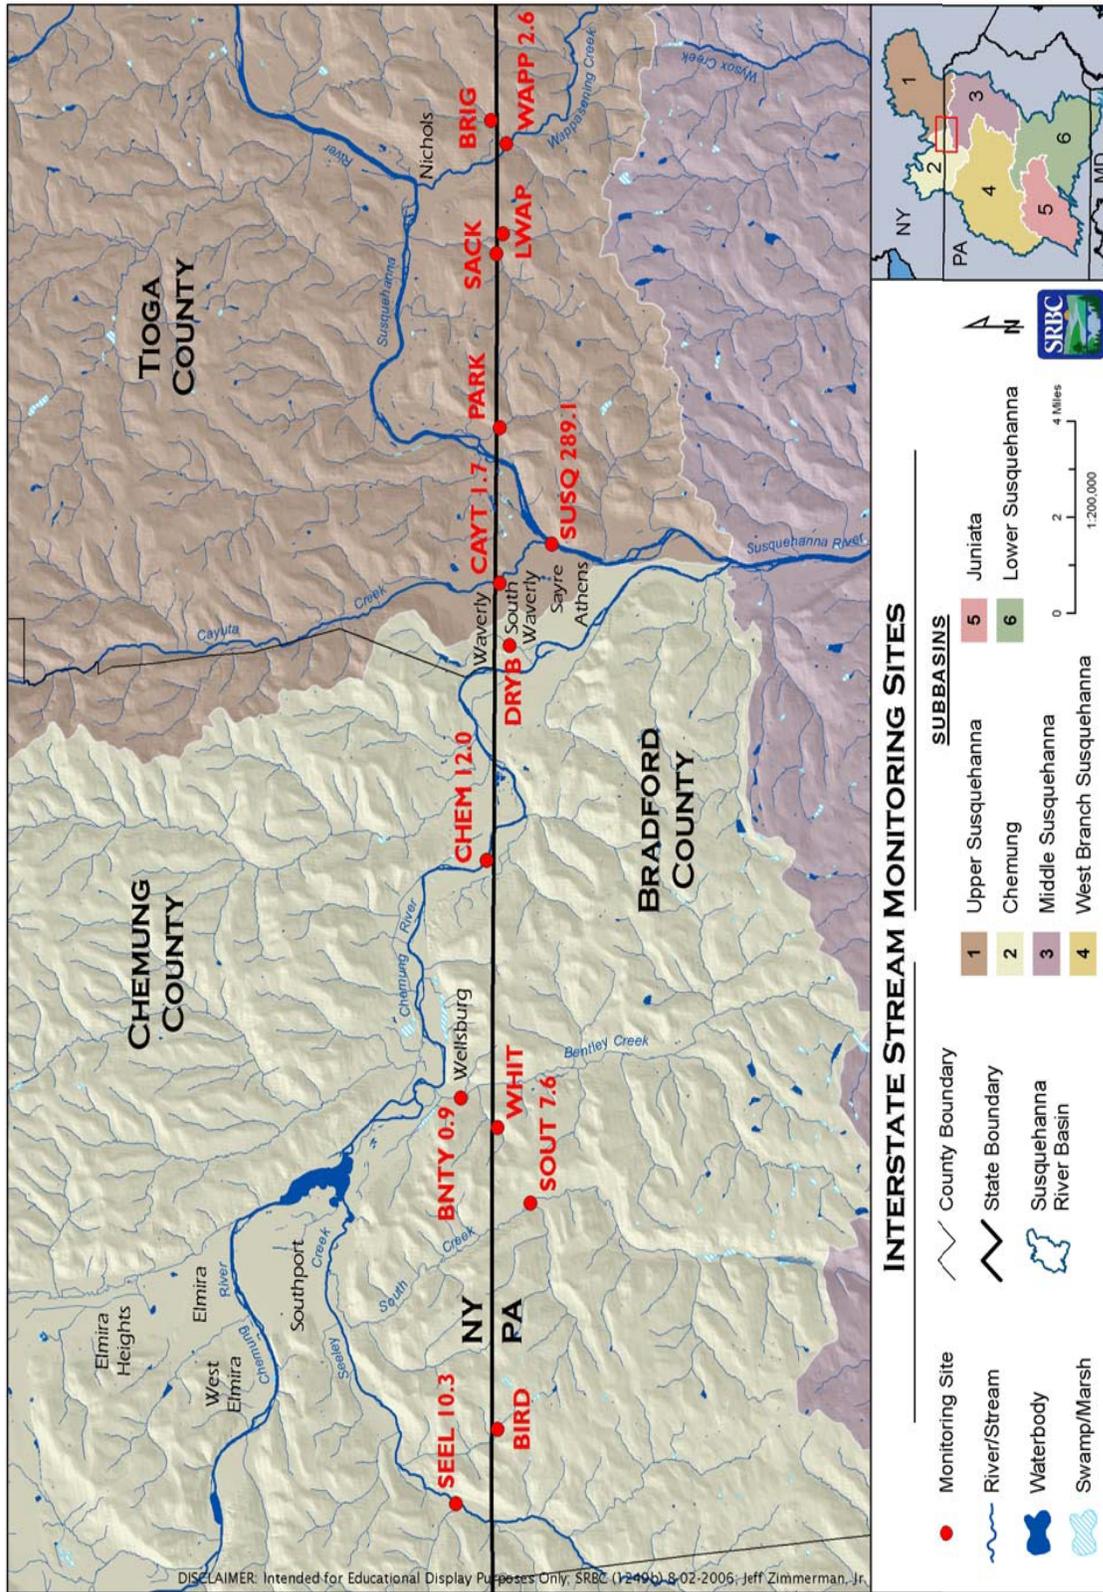


Figure 2. Interstate Streams Along the New York-Pennsylvania Border Between Seelye Creek and Briggs Hollow

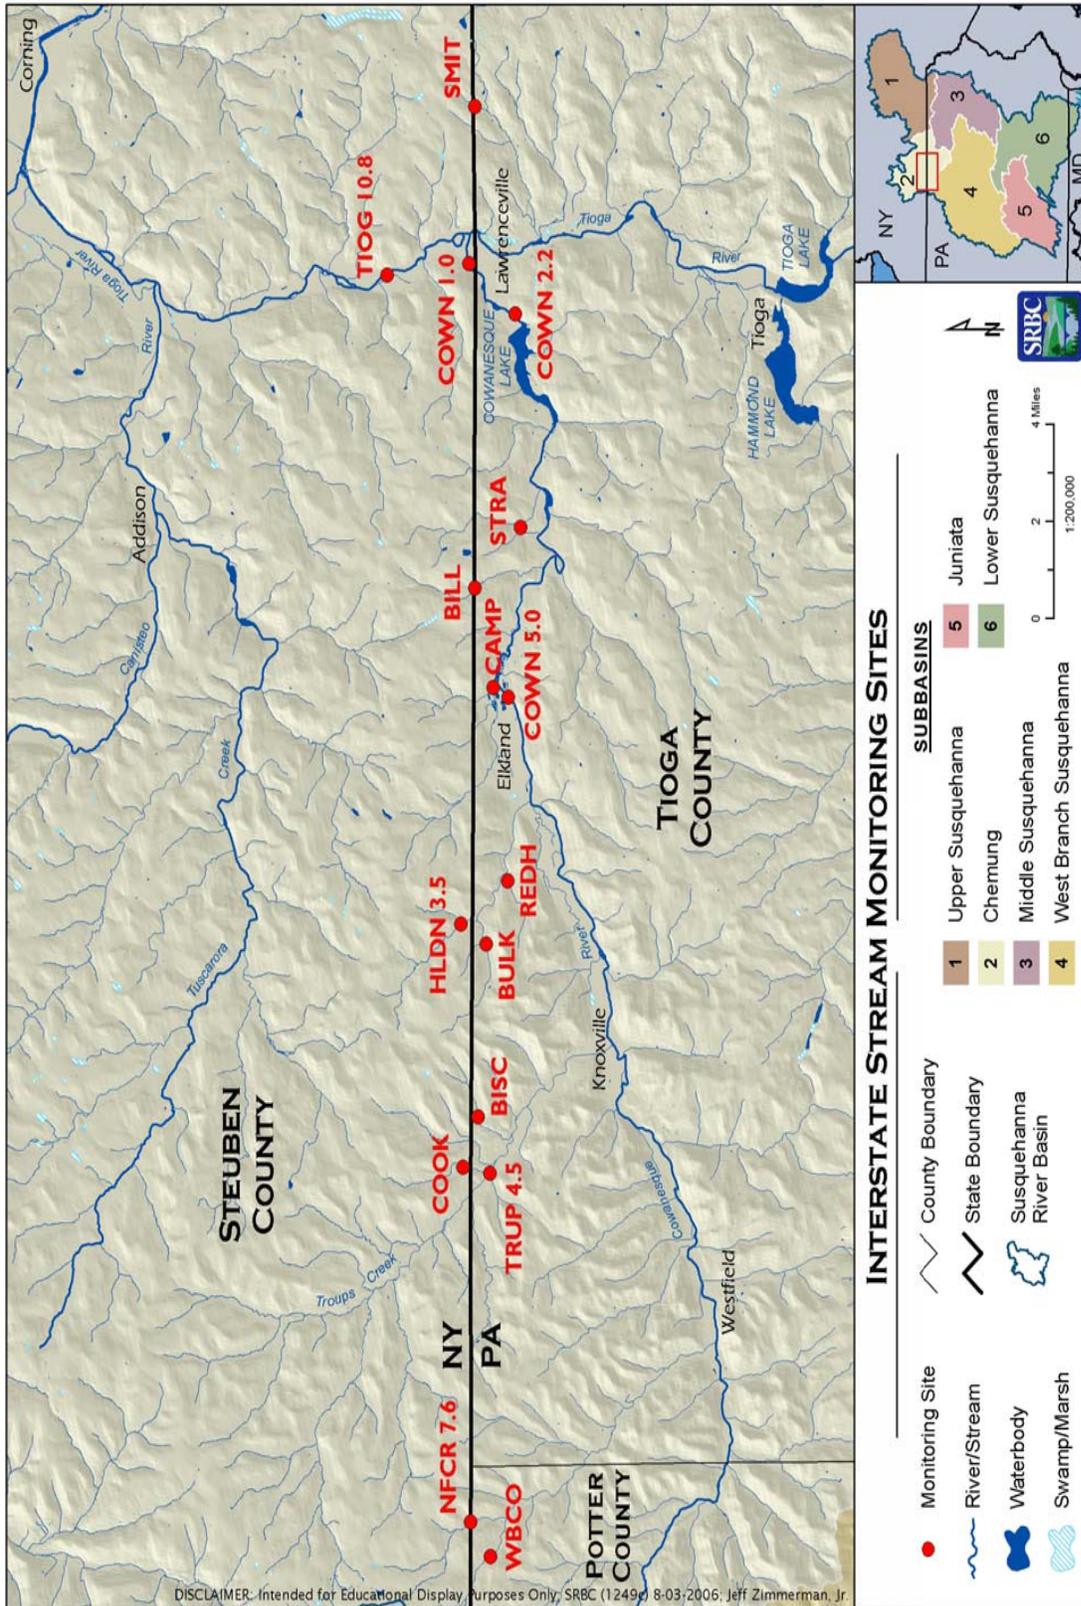


Figure 3. Interstate Streams Along the New York-Pennsylvania Border Between White Branch Cowanesque River and Smith Creek

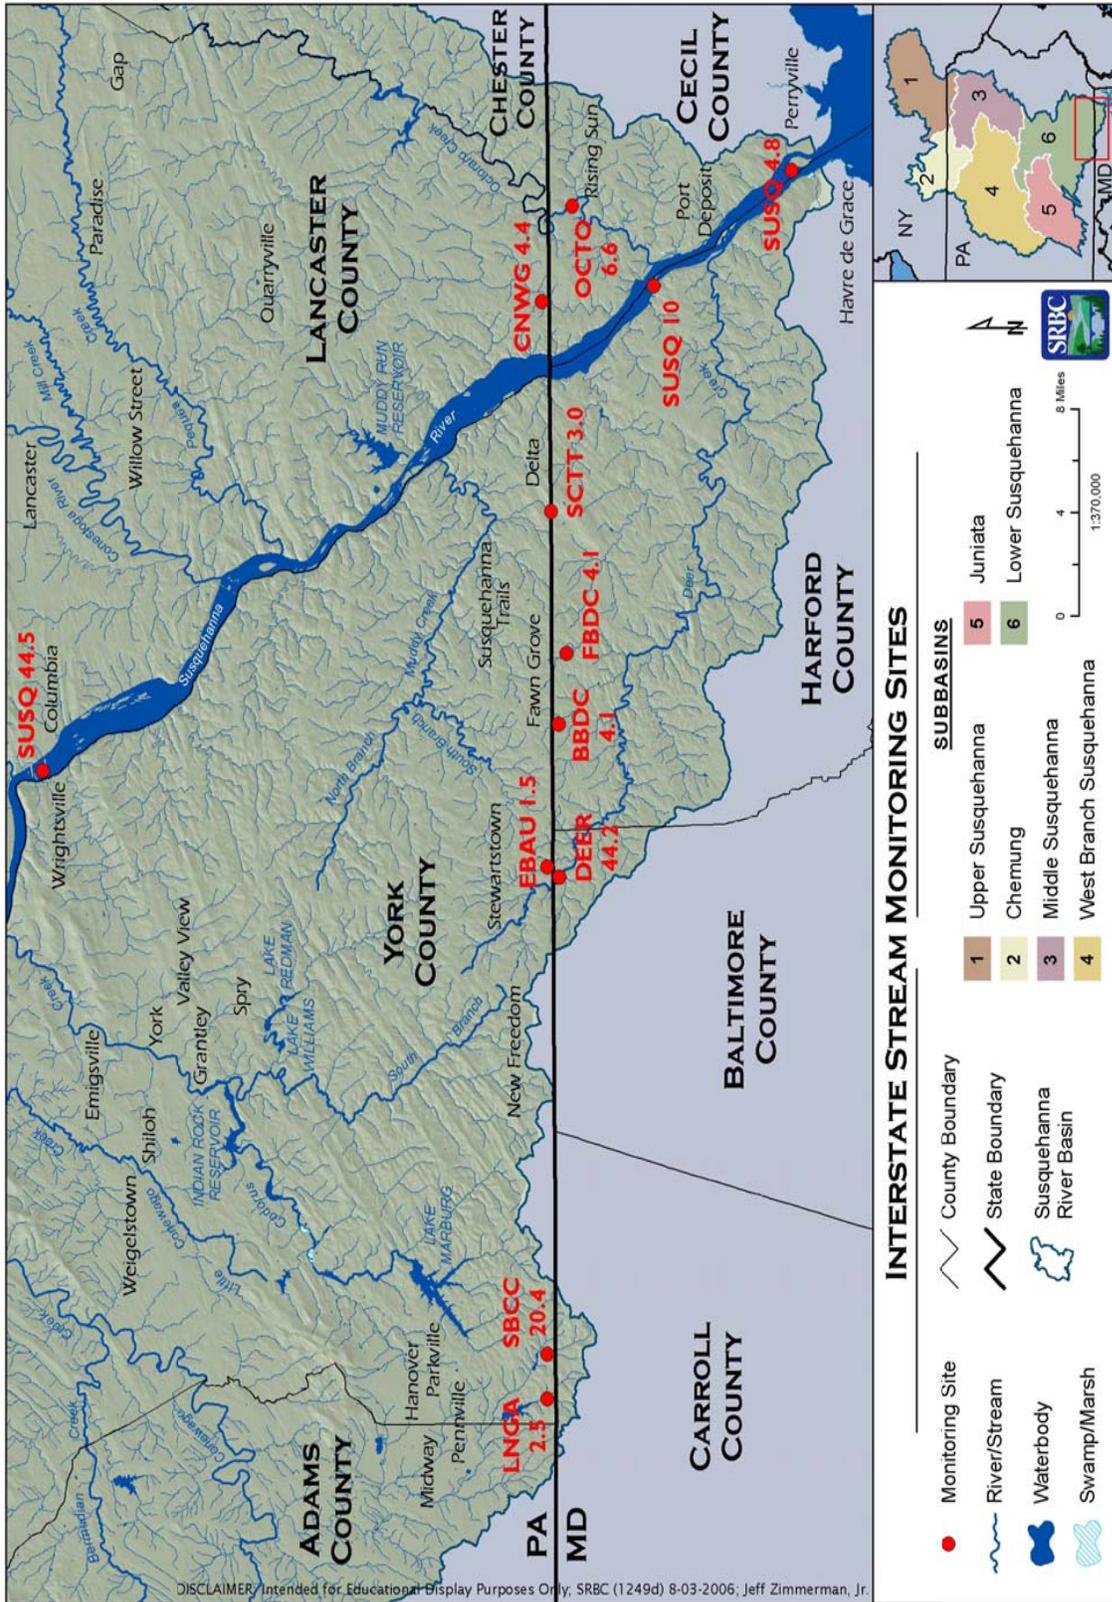


Figure 4. Interstate Streams Along the Pennsylvania-Maryland Border

Table 4. Monitored Parameters

Parameter	STORET Code
Physical	
Discharge	00060
Temperature	00010
Chemical	
Field Analyses	
Conductivity	00095
Dissolved Oxygen	00300
pH	00400
Alkalinity	00410
Acidity	00435
Laboratory Analyses	
Solids, Total	00500
Ammonia as Nitrogen, Total	00610
Nitrite as Nitrogen, Total	00615
Nitrate as Nitrogen, Total	00620
Nitrogen, Total	00600
Phosphorus, Total	00665
Orthophosphate, Total	70507
Organic Carbon, Total	00680
Calcium, Total	00916
Magnesium, Total	00927
Chloride, Total	00940
Sulfate, Total	00945
Iron, Total	01045
Manganese, Total	01055
Aluminum, Total	01105
Turbidity	82079

Macroinvertebrate and physical habitat sampling

SRBC staff collected benthic macroinvertebrate samples from Group 1 and Group 2 stations between July 13 and August 26, 2004, and from Group 3 streams between May 23 and 25, 2004. The benthic macroinvertebrate community was sampled to provide an indication of the biological condition of the stream. Macroinvertebrates are defined as aquatic insects and other invertebrates too large to pass through a No. 30 sieve.

Benthic macroinvertebrate samples were analyzed using field and laboratory methods described in Rapid Bioassessment Protocol for Use in Streams and Rivers by Barbour and others (1999). Sampling was performed using a 1-meter-square kick screen with size No. 30 mesh. The kick screen was stretched across the current to collect organisms dislodged from riffle/run areas by physical agitation of the stream substrate. Two kick screen samples were collected from a representative riffle/run at each station. The two samples were composited and preserved in denatured ethyl alcohol for later laboratory analysis.

In the laboratory, composite samples were sorted into 200-organism subsamples using a gridded pan and a random numbers table. The organisms contained in the subsamples were identified to genus (except Chironomidae and Oligochaeta) and enumerated using keys developed by Merrit and Cummins (1996), Peckarsky and others (1990), and Pennak (1989). Each taxon was assigned an organic pollution tolerance value and a functional feeding category as outlined in Appendix B. A taxa list for each station can be found in Appendix C.

Physical habitat conditions at each station were assessed using a slightly modified version of the habitat assessment procedure outlined by Barbour and others (1999). Eleven habitat parameters were field-evaluated at each site and used to calculate a site-specific habitat assessment score. Habitat parameters were evaluated on a scale of 0 to 20 and were based on instream composition, channel morphology, and riparian zone and bank conditions. Some of the parameters to be evaluated varied based on whether the stream was characterized by riffles and runs or by glides and pools. Table 5 summarizes criteria used to evaluate habitat parameters.

Data Synthesis Methods

Chemical water quality

Results of laboratory analysis for chemical parameters were compared to New York, Pennsylvania, and Maryland State water quality standards. In addition, a simple WQI was calculated, using procedures established by McMorrin and Bollinger (1990). The WQI was used to make comparisons between sampling periods and stations within the same geographical region; therefore, the water quality data were divided into two groups. One group contained stations along the NY-PA border, and the other group contained stations along the PA-MD border. The data in each group were sorted by parameter and ranked by increasing order of magnitude, with several exceptions. Dissolved oxygen was ranked by decreasing order of magnitude, while pH, alkalinity, acidity, calcium, and magnesium were not included in the WQI analysis. The values of each chemical analysis were divided by the highest ranking value in the group to obtain a percentile. The WQI score was calculated by averaging all percentile ranks for each sample. WQI scores range from 1 to 100, and high WQI scores indicate poor water quality. Water quality scores and a list of parameters exceeding standards for each site can be found in the “Bioassessment of Interstate Streams” section, beginning on page 33.

Reference category designations

Three reference sites were included in this study. These three sites represented the best available suite of conditions, in terms of biological community, water quality, and habitat for each of the categories. Sites located on the NY-PA border were compared to Cascade Creek (CASC 1.6) at Lanesboro, PA. Cascade Creek represented the best combination of biological, water quality, and habitat conditions in the Northern Appalachian Plateau and Uplands Ecoregion. Since only three macroinvertebrate samples were collected on the river stations during fiscal year 2005, these samples (SUSQ 365, COWN 1.0 and COWN 2.2) were included in the analysis for the NY-PA border sites. Deer Creek (DEER 44.2) near Gorsuch Mills, MD, served as the reference site for sampling stations located on the PA-MD border. Deer Creek had the best combination of biological, water quality, and habitat conditions in the Northern Piedmont Ecoregion (Omernik, 1987). Deep Hollow Brook (DEEP) near Danville, NY, served as the reference site for Group 3 sites, as it had the best biological, habitat, and field chemistry conditions of these sites.

Table 5. Criteria Used to Evaluate Physical Habitat

Habitat Parameter	OPTIMAL (20-16)	SUBOPTIMAL (15-11)	MARGINAL (10-6)	POOR (5-0)
1. Epifaunal Substrate (R/R)¹	Well-developed riffle/run; riffle is as wide as stream and length extends 2 times the width of stream; abundance of cobble.	Riffle is as wide as stream but length is less than 2 times width; abundance of cobble; boulders and gravel common.	Run area may be lacking; riffle not as wide as stream and its length is less than 2 times the width; some cobble present.	Riffle or run virtually nonexistent; large boulders and bedrock prevalent; cobble lacking.
1. Epifaunal Substrate (G/P)²	Preferred benthic substrate abundant throughout stream site and at stage to allow full colonization (i.e. log/snags that are not new fall and not transient).	Substrate common but not prevalent or well suited for full colonization potential.	Substrate frequently disturbed or removed.	Substrate unstable or lacking.
2. Instream Cover (R/R)	> 50% mix of boulders, cobble, submerged logs, undercut banks or other stable habitat.	30-50% mix of boulder, cobble, or other stable habitat; adequate habitat.	10-30% mix of boulder, cobble, or other stable habitat; habitat availability less than desirable.	< 10% mix of boulder, cobble, or other stable habitat; lack of habitat is obvious.
2. Instream Cover (G/P)	> 50% mix of snags, submerged logs, undercut banks or other stable habitat; rubble, gravel may be present.	30-50% mix of stable habitat; adequate habitat for maintenance of populations.	10-30% mix of stable habitat; habitat availability less than desirable.	Less than 10% stable habitat; lack of habitat obvious.
3. Embeddedness^a (R/R)	Gravel, cobble, and boulder particles are 0-25% surrounded by fine sediments.	Gravel, cobble, and boulder particles are 25-50% surrounded by fine sediments.	Gravel, cobble, and boulder particles are 50-75% surrounded by fine sediments.	Gravel, cobble, and boulder particles are >75% surrounded by fine sediments.
3. Pool Substrate Characterization (G/P)	Mixture of substrate materials, with gravel and firm sand prevalent; root mats and submerged vegetation common.	Mixture of soft sand, mud, or clay; mud may be dominant; some root mats and submerged vegetation present.	All mud or clay or sand bottom; little or no root mat; no submerged vegetation.	Hard-pan clay or bedrock; no root mat or vegetation.
4. Velocity/Depth Regimes^b (R/R)	All 4 velocity/depth regimes present (slow/deep, slow/shallow, fast/deep, fast/shallow).	Only 3 of 4 regimes present (if fast/shallow is missing, score lower than if missing other regimes).	Only 2 of 4 regimes present (if fast/shallow or slow/shallow are missing, score low).	Dominated by 1 velocity/depth regime.
4. Pool Variability^c (G/P)	Even mix of large-shallow, large-deep, small-shallow, small-deep pools present.	Majority of pools large-deep; very few shallow.	Shallow pools much more prevalent than deep pools.	Majority of pools small-shallow or pools absent.

Table 5. Criteria Used to Evaluate Physical Habitat—Continued

Habitat Parameter	OPTIMAL (20-16)	SUBOPTIMAL (15-11)	MARGINAL (10-6)	POOR (5-0)
5. Sediment Deposition (R/R)	Little or no enlargement of islands or point bars and <5% of the bottom affected by sediment deposition.	Some new increase in bar formation, mostly from coarse gravel; 5-30% of the bottom affected; slight deposition in pools.	Moderate deposition of new gravel, coarse sand on old and new bars; 30-50% of the bottom affected; sediment deposits at obstructions; moderate deposition of pools prevalent.	Heavy deposits of fine material, increased bar development; >50% of the bottom changing frequently; pools almost absent due to sediment deposition.
5. Sediment Deposition (G/P)	Less than 20% of bottom affected; minor accumulation of fine and coarse material at snags and submerged vegetation; little or no enlargement of island of point bars.	20-50% affected; moderate accumulation; substantial sediment movement only during major storm event; some new increase in bar formation.	50-80% affected; major deposition; pools shallow, heavily silted; embankments may be present on both banks; frequent and substantial movement during storm events.	Channelized; mud, silt, and/or sand in braided or non-braided channels; pools almost absent due to substantial sediment deposition.
6. Channel Flow Status (R/R) (G/P)	Water reaches base of both lower banks and minimal amount of channel substrate is exposed.	Water fills >75% of the available channel; or <25% of channel substrate exposed.	Water fills 25-75% of the available channel and/or riffle substrates are mostly exposed.	Very little water in channel and mostly present as standing pools.
7. Channel Alteration^d (R/R) (G/P)	No channelization or dredging present.	Some channelization present, usually in areas of bridge abutments; evidence of past channelization (>20 yr) may be present, but not recent.	New embankments present on both banks; and 40-80% of stream reach channelized and disrupted.	Banks shored with gabion or cement; >80% of the reach channelized and disrupted.
8. Frequency of Riffles (R/R)	Occurrence of riffles relatively frequent; distance between riffles divided by the width of the stream equals 5 to 7; variety of habitat.	Occurrence of riffles infrequent; distance between riffles divided by the width of the stream equals 7 to 15.	Occasional riffle or bend; bottom contours provide some habitat; distance between riffles divided by the stream width is between 15-25.	Generally all flat water or shallow riffles; poor habitat; distance between riffles divided by the width of the stream is >25.
8. Channel Sinuosity (G/P)	The bends in the stream increase the stream length 3 to 4 times longer than if it was in a straight line.	The bends in the stream increase the stream length 2 to 3 times longer than if it was in a straight line.	The bend in the stream increase the stream length 1 to 2 times longer than if it was in a straight line.	Channel straight; waterway has been channelized for a long time.
9. Condition of Banks^e (R/R) (G/P)	Banks stable; no evidence of erosion or bank failure, little potential for future problems; <5% of bank affected; on Glide/Pool streams side slopes generally <30%.	Moderately stable; infrequent, small areas of erosion mostly healed over; 5-30% of bank in reach has areas of erosion; on Glide/Pool streams side slopes up to 40% on one bank; slight erosion potential in extreme floods.	Moderately unstable, 30-60% of banks in reach have areas of erosion; high erosion potential during floods; on Glide/Pool streams side slopes up to 60% on some banks.	Unstable; many eroded areas; "raw" areas frequent along straight sections and bends; on side slopes, 60-100% of bank has erosional scars; on Glide/Pool streams side slopes > 60% common.
(score each bank 0-10)	(9-10)	(6-8)	(3-5)	(0-2)

Table 5. Criteria Used to Evaluate Physical Habitat—Continued

Habitat Parameter	OPTIMAL (20-16)	SUBOPTIMAL (15-11)	MARGINAL (10-6)	POOR (5-0)
10. Vegetative Protective Cover (R/R) (G/P) (score each bank 0-10)	>90% of the streambank surfaces covered by vegetation; vegetative disruption through grazing or mowing minimal. (9-10)	70-90% of the streambank surfaces covered by vegetation; disruption evident but not affecting full plant growth potential to any great extent. (6-8)	50-70% of the streambank surfaces covered by vegetation; disruption obvious; patches of bare soil or closely cropped vegetation. (3-5)	<50% of the streambank surfaces covered by vegetation; disruption is very high; vegetation removed to 5 cm or less. (0-2)
11. Riparian Vegetative Zone Width (R/R) (G/P) (score each bank 0-10)	Width of riparian zone >18 meters; human activities (i.e. parking lots, roadbeds, clearcuts, lawns, or crops) have not impacted zone. (9-10)	Width or riparian zone 12-18 meters; human activities have impacted zone only minimally. (6-8)	Width of riparian zone 6-12 meters; human activities have impacted zone only minimally. (3-5)	Width of riparian zone <6 meters; little or no riparian vegetation due to human activities. (0-2)

¹R/R – Riffle/Run

²G/P – Glide/Pool

^a Embeddedness

^b Velocity/Depth Regimes

^c Pool Variability

^d Channel Alteration

^e Condition of Banks

Habitat assessment parameters used for streams characterized by riffles and runs.

Habitat assessment parameters used for streams characterized by glides and pools.

The degree to which the substrate materials that serve as habitat for benthic macroinvertebrates and for fish spawning and egg incubation (predominantly cobble and/or gravel) are surrounded by fine sediment. Embeddedness is evaluated with respect to the suitability of these substrate materials as habitat for macroinvertebrates and fish by providing shelter from the current and predators and by providing egg deposition and incubation sites.

The general guidelines are 0.5 m depth to separate shallow from deep, and 0.3 m/sec to separate fast from slow.

Rated based on the variety and spatial complexity of slow- or still-water habitat within the sample segment. It should be noted that even in high-gradient segments, functionally important slow-water habitat may exist in the form of plunge-pools and/or larger eddies. General guidelines are any pool dimension (i.e., length, width, oblique) greater than half the cross-section of the stream for separating large from small and 1 m depth separating shallow and deep.

A measure of large-scale changes in the shape of the stream channel. Channel alteration includes: concrete channels, artificial embankments, obvious straightening of the natural channel, rip-rap, or other structures.

Steep banks are more likely to collapse and suffer from erosion than are gently sloping banks and are therefore considered to be unstable. Left and right bank orientation is determined by facing downstream.

Source: Modified from Barbour and others, 1999.

Biological and physical habitat conditions

Benthic macroinvertebrate samples were assessed using procedures described by Barbour and others (1999), Klemm and others (1990), and Plafkin and others (1989). Using these methods, staff calculated a series of biological indexes for a stream and compared them to a reference station in the same region to determine the degree of impairment. The metrics used in this survey are summarized in Table 6. Metric 2 (Shannon Diversity Index) followed the methods described in Klemm and others (1990), and all other metrics were taken from Barbour and others (1999).

The 200-organism subsample data were used to generate scores for each of the seven metrics. Scores for metrics 1-4 were converted to a biological condition score, based on the percent similarity of the metric score, relative to the metric score of the reference site. Scores for metrics 5-7 were based on set scoring criteria developed for the percentages (Plafkin and others, 1989; Ohio Environmental Protection Agency, 1987b). The sum of the biological condition scores constituted the total biological score for the sample site, and total biological scores were used to assign each site to a biological condition category (Table 7). Habitat assessment scores of sample sites were compared to those of reference sites to classify each sample site into a habitat condition category (Table 8).

Trend analysis

Long-term trend analysis has been performed on Group 1 streams that have been sampled since April 1986 to identify increases and decreases over time in total suspended solids, total ammonia, total nitrogen, total phosphorus, total chloride, total sulfate, total iron, total manganese, total aluminum, and the WQI. Overall these long-term trends do not change very much from year to year. Therefore, SRBC has decided to analyze for trends every five years. A trend analysis will not be performed in this report. The next trend analysis will be in the 2008 Interstate Report.

The nonparametric trend test used in previous reports was the Seasonal Kendall Test, which is described by Bauer and others (1984), and Smith and others (1982). For more information on this test and how it was used to assess trends in the data see Trends in Nitrogen, Phosphorus, and Suspended Sediment in the Susquehanna River Basin, 1974-93 (Edwards, 1995), LeFevre (2003), and other previous Interstate reports.

RESULTS

Water Quality

During fiscal year 2005, water quality in approximately 40 percent of the Group 1 and Group 2 interstate streams continued to meet designated use classes and water quality standards (Table 9, Appendix D). Nineteen out of the 32 sites had parameters exceeding water quality standards, with 16 of those having more than one violation. The parameter that most frequently exceeded water quality standards was total iron (Table 10, Figure 5). Seventy-two out the 734 possible observations (based on the number of applicable water quality standards of each state) exceeded water quality standards.